

Date: Thursday, 29/05/2008 9:05:49 AM
 User: Julie Lecocq

Process Sheet

Customer :	CU-DAR001 Dart Helicopters Services	Drawing Name :	AFT X-TUBE EXT HEIGHT GEAR
Job Number :	39550		
Estimate Number :	10421		
P.O. Number :		Part Number :	D205596103
This Issue :	29/05/2008	S.O. No. :	
Prsht Rev. :	NC	Drawing Number :	D205-596-103
First Issue :	1 / 1	Project Number :	N/A
Previous Run :	39549	Drawing Revision :	B
	Type :	Material :	
	CROSSTUBES	Due Date :	13/06/2008
Written By :		Qty:	1 Um: Each
Checked & Approved By :	JLD 08.5.29		
Comment :	Est Rev:G 05.06.10 Acid etch moved to Step 11 KJ/JLM Est RevH 08-01-10 ECN 1075 DD Est Rev F 08.04.28 Added bending & mat'l EC verified by: DD		

Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL



JLD 08.5.30



Comment: DOCUMENT CONTROL

Photocopy D205-594 bluefile & type labels per PPP D205-596-103 CHG002

2.0

D6008180

Crosstube Extrusion



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)

Crosstube Extrusion

Batch: B40271

DP

8-7-21

3.0

BENDING CROSS

BENDING MACHINE - CROSSTUBES



Comment: BENDING MACHINE - CROSSTUBES

Bend as per dwg D2890 using CNC bender program

DP 8-7-21

4.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Mark 37.30" for cutting from tangential line in the straight section from D2890 as per Dwg wall template.

DP 8-7-21

5.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

20609.21

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 29/05/2008 9:05:49 AM
User: Julie Lecocq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT X-TUBE EXT HEIGHT GEAR

Job Number: 39550

Part Number: D205596103

Job Number:



Seq. #:

Machine Or Operation:

Description :

6.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Cut as per Dwg D205-596-103

2-Deburr & Inspect for surface damage. Polish cut surface. Scribe part # and batch # on one end of tube.

ANM
8-7-21

7.0

QC15

DIMENSIONAL CHECK OF X-TUBES



Comment: DIMENSIONAL CHECK OF X-TUBES

S 08/04/22 @

8.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

TOUCH UP Chemical Conversion Coat as per QSI 005 4.1

ANM
8-7-21

9.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

S 08/04/22 @

10.0

SPRAY PAINTING

SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside with Immron per QSI 005 4.2

ml 08 07 23 (1)

11.0

QC14

INSPECT SPRAY PAINT



Comment: Inspect Spray Paint

Job 0723 (1)

12.0

D3595063530

RUBBER CUSHION



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

RUBBER CUSHION
batch 38865

ml 08 07 23

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 29/05/2008 9:05:49 AM
User: Julie Lecoq

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: AFT X-TUBE EXT HEIGHT GEAR

Job Number: 39550

Part Number: D205596103

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

MS2192028

Clamp(per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)
clamp(per MIL-DTL-8783C)
batch 108041

ml 08 07 23

14.0

D29401

Support



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)
Pick:
Qty Part number Description Batch
2 D2940-1 Support 35478

ml 08 07 23

15.0

CROSSTUBES

CROSSTUBES RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1- Lightly scuff the bonded area using a 320 grit sand paper and clean the area with 41058 wash 'n' wipe

2- Apply magnobond 6398 as per dwg D205-596-103

Magnobond 6398 Batch: 107621

EXP: 08/2009 Time: 1:45 pm

3- Install supports and clamps per Dwg D205-596-103. Torque clamps to 80-100 in lb. as per dwg

ml 08 07 23 (1)

08 07 24 (1)

16.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08 07 24 (1)

17.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D205-596-103

Location: Rev G

AS 08 07 24 (2)

18.0

QC21

FINAL INSPECTION/W/O RELEASE



Comment: FINAL INSPECTION/W/O RELEASE

08 07 24 (3)

Job Completion



W 08 07 24

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____


QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD		Work Order:	39550
Description: Crosstube High-High Aft		Part Number:	D205-596-103
Inspection Dwg: D205-596-103 Rev: B		Page 1 of 1	

Required Dimension	Min	Max
Height	37.2	37.4
1/2 Span	58.7	58.9
Angle	49	52
Total Span	117.4	117.8

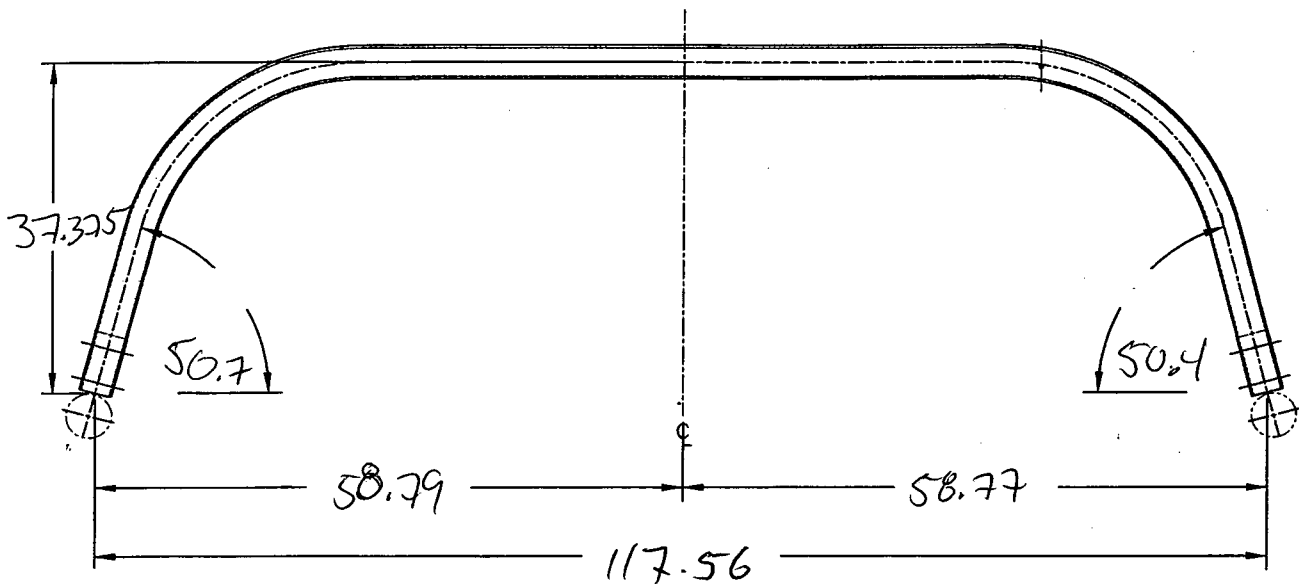

Comments

QC15 Inspection	<i>[Signature]</i>
Date	

Rev	Date	Change	Revised by	Approved
A	07.02.06	New Issue	KJ/JM	
B	08.04.21	Dwg Rev updated	KJ/JM	<i>[Signature]</i>

B 39550 D205-596-103

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

PARTS LIST:

Qty	Part Number	Description
X	D205-596-103	CROSSTUBE ASSEMBLY, HI-HI AFT
1	D6008-180	CROSSTUBE
2	D2940-1	SUPPORT
4	D3595-063-530	RUBBER CUSHION
4	MS21920-28	CLAMP
A/R	MAGNOBOND 6398	ROCKWELL SPECIFICATION RBO-120-023 ADHESIVE (TEXTRON/BELL SPEC. 299-947-100, TYPE II, CLASS 2 ADHESIVE)

GENERAL NOTES:

- 1) MATERIAL: MANUFACTURE FROM D6008-180
FINISHED LENGTH = 146.98 ± 0.02
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART 005 4.2
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH
VIBRATING STYLUS
- 7) WEIGHT: 55 lbs
- 8) PART IS SYMMETRIC ABOUT CENTERLINE
- 9) BEND PROGRESSIVELY WITH A MINIMUM OF 3 PASSES. MAXIMUM TUBE FLATTENING DUE TO
BENDING IS 6% BASED ON O.D.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE
OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS
SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT
LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) APPLY A 0.03" TO 0.06" THICK LAYER OF MAGNOBOND 6398 TO THE SURFACE OF D2940-1 THAT
WILL BE IN CONTACT WITH THE CROSSTUBE. LET CURE FOR 12 HOURS AFTER INSTALLATION
AND PRIOR TO PACKAGING.
- 12) INSTALL MS21920-28 CLAMPS WITH D3595-063-530 RUBBER CUSHIONS TO SECURE D2940-1 SHOP COPY
SUPPORT ON THE TOP SIDE OF THE CROSSTUBE. ENSURE CLAMPS ARE OPPOSITE
CROSSTUBE SUPPORT. RETURN TO
ENGINEERING
NOTE: IT IS ACCEPTABLE TO SUBSTITUTE MS21920-28 CLAMPS WITH LONGER OR SHORTER CONTROLLED COPY
MS21920-XX CLAMPS TO ACCOMODATE VARYING DIAMETERS. ENSURE THERE IS A MINIMUM OF
1.5 THREADS IN SAFETY ON THE NUTS. AMENDMENT
WITHOUT NOTICE
WORK ORDER
- 13) TORQUE CLAMPS 80 TO 100 IN-LB

B	SUPPORT NOW MAGNOBONDED; REMOVE D2856-600-1009 ABRASION STRIP; UPDATED NOTES; ADDED D3595-063-530 CUSHION	MB	07.12.03
A	NEW ISSUE	DS	02.05.27
REV.	DESCRIPTION	BY	DATE
DESIGN	<i>[Signature]</i>	DART AEROSPACE LTD	
DRAWN	<i>[Signature]</i>	HAWKESBURY, ONTARIO, CANADA	
CHECKED	<i>[Signature]</i>	DRAWING NO.	REV. B
MFG. APPR.	<i>[Signature]</i>	D205-596-103	SHEET 1 OF 2
APPROVED	<i>[Signature]</i>	TITLE	SCALE
DE APPR.	<i>[Signature]</i>	CROSSTUBE ASSEMBLY, HI-HI AFT	NTS
DATE	07.12.03	COPYRIGHT © 2002 BY DART AEROSPACE LTD THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

